

Karnataka State Fire And Emergency Services Department



Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Dire Station, Raichur-584102.



C.NO: 71/FSR/DFO/RCR/2026

Date:27/03/2026

"Fire Safety Recommendation"

ANNEXURE-I

Group-B Educational Building

"B1 And B2- Schools Up to Senior Secondary Level and other institutions"
NBC-2016, Part-4, Table 7 (11) 3. 1. 3 Group-B Educational Buildings

To,
The President
BVR Memorial Education Trust (R) Manvi
Taluk|| Manvi, Dist.Raichur-584123.

Sir/Madam,

Sub:- Issue of "Fire Safety Recommendation" to BVR Memorial Education Trust (R) Manvi, Taluk|| Manvi, Dist.Raichur-584123. Constructed Low Rise School Building BVR International School , Situated At- Sy .No 460/2/1 MPL NO.15-7-699/460/2/9 PIDNo 19-17-6454069 Manvi , Taluk. Manvi, Dist.Raichur-584123.

Ref :- 1).C.No:08/FSO/Manvi/2026, Date:21/03/2026
2).Applicant Request Letter on Dated: 20/03/2026.


With reference to the subject above cited, the Premises to to BVR Memorial Education Trust (R) Manvi Taluk|| Manvi, Dist.Raichur-584123. Constructed Low Rise School Building BVR International School,Situated At- Sy .No 460/2/1 MPL NO.15-7-699/460/2/9 PIDNo 19-17-6454069 Manvi , Taluk. Manvi, Dist.Raichur-584123. has inspected by FSO Manvi on Dated:-21/03/2026 with respect to fire Prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A. Details of the Building/Premises:-

01.	Name and Address of the applicant.	: The President BVR Memorial Education Trust (R) Manvi Taluk Manvi, Dist.Raichur-584123.
02.	Name and Address of the premises.	: BVR International School ,Situated At- Sy .No 460/2/1 MPL NO.15-7-699/460/2/9 PID.No19-17-6454069 Manv, Taluk Manvi, Dist.Raichur-584123
03.	Name and Address of the Building owner.	: Mr Praveen Kumar Reddy Bogoli S/O B V.Venkatram Reddy Situated At- Sy .No 460/2/1 MPL NO.15-7-699/460/2/9 PID.No 19-17-6454069 ,Taluk Manvi, Dist.Raichur-584123
04.	Number of Buildings	: 01 No.
05.	Number of floor	: Ground floor+ 1 upper Floors.
06.	Floor-wise details of occupancy :-	
	Ground Floor	: 1).Anti Room-02 No's. 2).Staff room-01 No.

Page 1 of 4

PRESIDENT
BVR Memorial Education Trust (R)
MANVI-584 123. Dist. Raichur

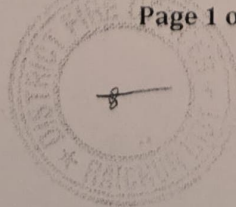

PRINCIPAL
BVR INTERNATIONAL SCHOOL
MANVI-584123. Dist. Raichur

			3).Conference Hall-01 No 4).Office Room-01 No 5).Incharge Room-01 No 6).Electricity Room-01 No 7).Accounts Room-01 No 8).Principal Room-01 No 9).Cash Counter-01 No 10).Toilet Room-02 No 11).Class Room-09 No 12).Stationary Room-01 No 13).Chairman Room-01 No
	First Floor	:	1).Staff Room-02 No's. 2).Seminor Hall-02 No 3).Class Room-14 No's 4).Toilet -01 No
07	Height of the building	:	07.60 Mtrs.
08	Site area	:	8094.00 Sq.Mtrs.
09	Built-up area of each floor :-		
10	Ground Floor	:	1864 Sq.Mtrs.
	First Floor	:	2015 Sq.Mtrs.
	Total built-up area	:	3879 Sq.Mtrs.
11	Surrounding properties:-		
	East	:	Sharada School
	West	:	Agriculure Land
	North	:	09.Mtr Road Manvi Yeagal Road
	South	:	Houses
12.	Set back area available around the Building:-		
	East	:	50.00 Mtrs.
	West	:	04.60 Mtrs.
	North	:	12.00 Mtrs.
	South	:	50.00 Mtrs.
			Recommended To provide: as per The Allowed Setback Shall be Kept from and Obstruction Further Construction Local Zonal Regulations.

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No [01]	Details [02]	Existing [03]	Recommendations [04]
01.	Accessibility to Premises.	The premises are accessible from 09.00 Mtrs. Wide Manvi Yeagal Road On Northern Side	Adequate.

Page 2 of 4

PRESIDENT
BVR Memorial Education Trust (R)
MANVI-584 123, Dist. Raichur

PRINCIPAL
BVR INTERNATIONAL SCHOOL
MANVI-584123, Dist. Raichur

		and the Road is hardened to carry the weight of 45,000 kgs.	
02	No of entrances.	01 No 07.50 Mtrs	-----
03	No. of staircases available	No of staircase	03 No.
		Width of staircase	3.20 Mtrs. 2.30 Mtrs. 2.30 Mtrs
		Width of treads	30 CM 30 CM 30 CM
		Height of risers	15 CM 15 CM 15 CM
		No of riser per flight	20 No's 13No's 13No's
		Height of handrails	-- -- --
	Head room clearance	-- -- --	
04	Portable Extinguisher	Not Provided	<p>Recommended to Provided :- Extinguishers as below mentioned 1).One ABC Type fire extinguisher each of 6 kg capacity For Every 100 m2. 2).One CO2 Fire Extinguisher of 4.5 kg Capacity shall be Provided near electrical Panel Board. [All the extinguishers suggested above should be with B.I. S markings and should be located at an easily accessible position without obstructing the normal passage and maintained periodically].</p>
05	Escape routes	Not Marked.	<p>Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in the corridor in each floor during evacuation.</p>
06	Fire order (Fire Safety Plans)	Not Displayed	<p>Recommended To Provide The Notice board have been indicted the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Manvi Fire Station-08538-220362 and the telephone number of nearest Ambulance services and Police Station.</p>
07	No Smoking Board	Not Displayed	<p>Recommended To Provide As per sec-4 of COPTA a board with words NO SMOKING AREA shall be written in English & Kannada both language shall be prominently displayed at inside the entry /exit of the each floor.</p>
	Fire Siren	Not Installed	<p>Recommended To Provide A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.</p>
08	Nominate	Not yet Nominated	Recommended To Provide

	one Fire Nodal Officer		A fire nodal officer shall be nominated either from teaching or non teaching staff.
09.	Nominate Fire Fighting Training	Not Imparted	Recommended To Provide At-least 40% of School Staff should be got trained in basic fire fighting at R.A. Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date
10	Fire Precautionary Measures:- <ul style="list-style-type: none"> A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area Class Rooms, Laboratory And Electrical Some Panel Premises. B. Accumulation of combustible Waste in and around the premises should be avoided. C. The Exit Ways Shall be always Kept Clear Without any obstruction. D. Liquefied Petroleum Gas Should Not be Stored in the building. E. The doors shall not kept Locked/ Latched during working hours and shall be free from obstruction. F. During the class hours in the class room doors shall not be locked from inside to outside. G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students <p>in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14th of Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.</p>		

Under the Circumstance stated above, there is No Objection to run Education activities in to **BVR Memorial Education Trust (R) Manvi Taluk|| Manvi, Dist.Raichur-584123**. Constructed Low Rise School Building **BVR International School ,Situatd At- Sy .No 460/2/1 MPL NO.15-7-699/460/2/9 PIDNo 19-17-6454069 Manvi, Taluk|| Manvi, Dist.Raichur-584123**. School Building subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Part-B. Therefore management should compulsory Karnataka Fire And Emergency Services Department conditions to provide Additional Equipments And Then Intimate to the office Within 90 days Positively Without Fail. **This Fire Safety Recommendation Certificate Valid for Only One Year From The date of issue and renewable without fail**.

School U-DISE Code:-29064101556.

To.

- 1).The DGP KSF&ES
Bangalore.
- 2).Fire Station Officer
Fire Station Manvi.

Your's faithfully

[Handwritten Signature] 27/03/26

[Handwritten Stamp]
BVR INTERNATIONAL SCHOOL
MANVI-584123

[Handwritten Signature]

PRINCIPAL
BVR INTERNATIONAL SCHOOL
MANVI-584123, Dist. Raichur

[Handwritten Signature]
PRESIDENT
BVR Memorial Education Trust (R)
MANVI-584 123, Dist. Raichur